



# FG MKII ICC REMOVAL

1. Remove top cover from above TFT screen. This can normally be achieved from pushing the front of the top cover up. Refer figure 1. Remove 2 screws holding ICC bracket to dash and remove the 2 plugs from the top of the screen. Refer figure 2.

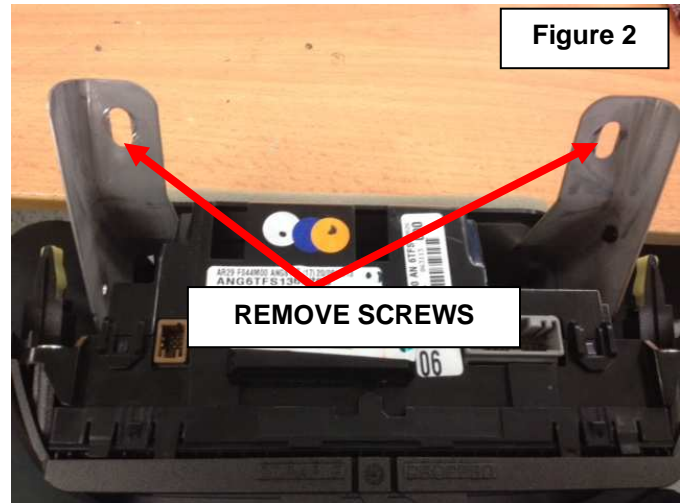

2. Remove tissue box holder from under stereo by grasping and pulling towards rear of vehicle and remove 4 x 8mm bolts and Antenna plug. Refer figure 3 & 4.

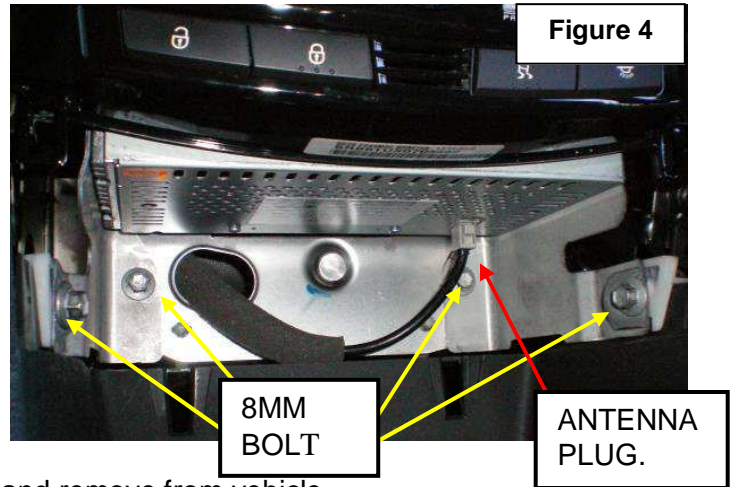

3. Grasp ICC and pull towards the rear of the vehicle and remove from vehicle.

# TERRITORY SZ ICC REMOVAL

4. Remove top cover from above TFT screen. This can normally be achieved by grasping the vents at the rear of the cover and pulling up. Refer figure 5. Remove 2 screws holding ICC bracket to dash and remove the 2 plugs from the top of the screen. Refer figure 6



- Remove the 2 rubber bases from the bottom of the drink holders and remove the screws and pull out the drink holder. Refer figure 7. Remove the surround from around the gear shifter. Refer figure 8.



Figure 7

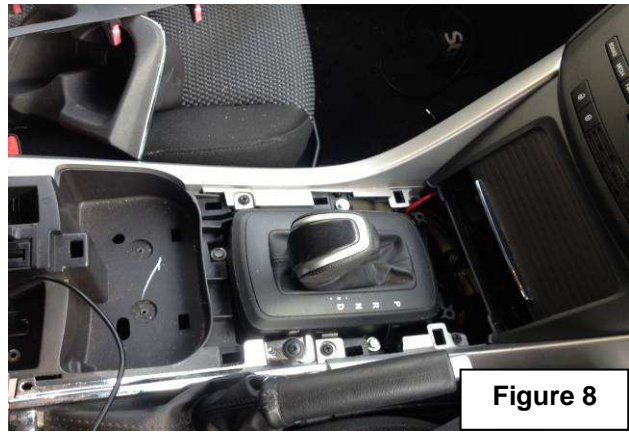


Figure 8

- Remove the centre storage compartment by grasping and pulling towards the rear of the vehicle. Refer figure 9.



Figure 9

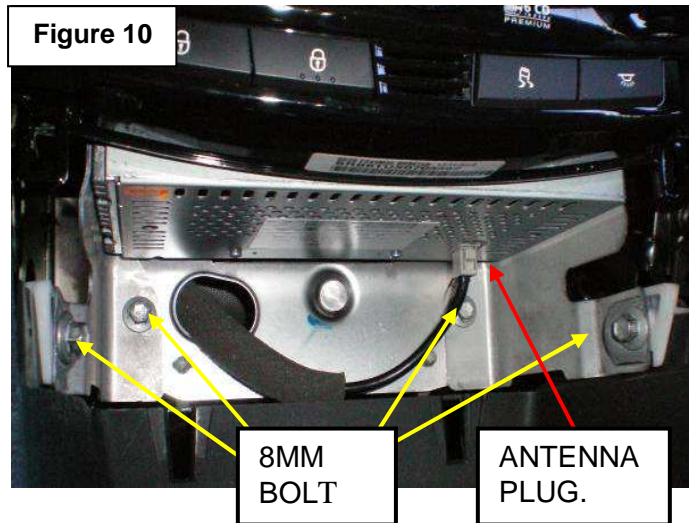


Figure 10

8MM  
BOLT

ANTENNA  
PLUG.

- Remove 4 x 8mm bolts and Antenna plug. Refer figure 10.
- Grasp ICC and pull towards the rear of the vehicle and remove from vehicle.
- Remove both brackets from either side of the stereo. Refer figure 11.
- Remove 4 screws holding the TFT screen to the facia.

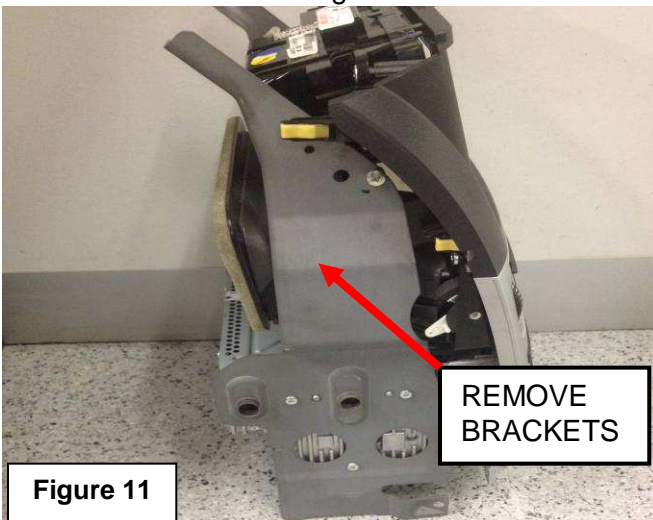


Figure 11

REMOVE  
BRACKETS


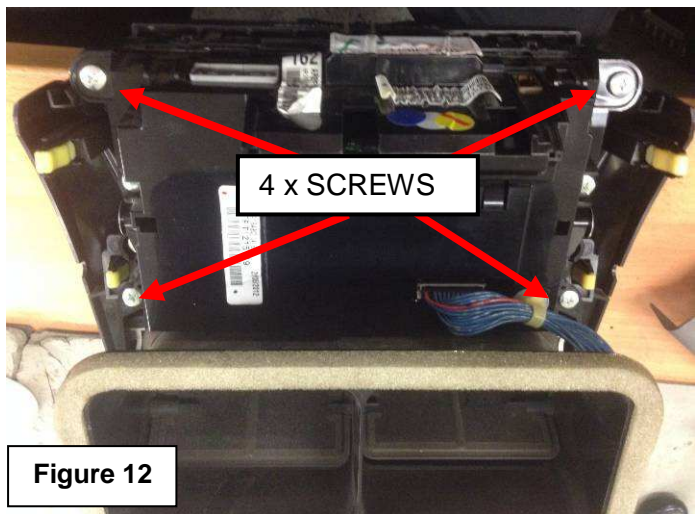


Figure 12

4 x SCREWS

11. To remove the connector from the rear of the TFT the cable tie can be opened with a set of tweezers or can be cut

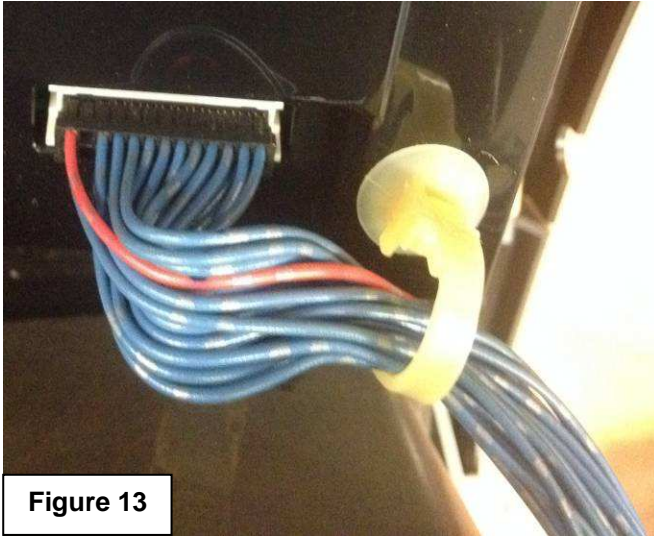

### **NOTE BEFORE SENDING:**

- . PLEASE SUPPLY FULL NAME AND ADDRESS AND CONTACT DETAILS**
- . ONLY SEND THE SCREEN - DO NOT SHIP THE COMPLETE ICC UNIT OTHERWISE EXTRA SHIPPING CHARGES WILL APPLY**

### **PLEASE SEND FAULTY SCREEN TO:**

**ATT: SERVICE  
ASL AUTOMEDIA  
13 COMMERCIAL DRIVE  
LYNBROOK VICTORIA 3975**